


USB驱动安装和卸载

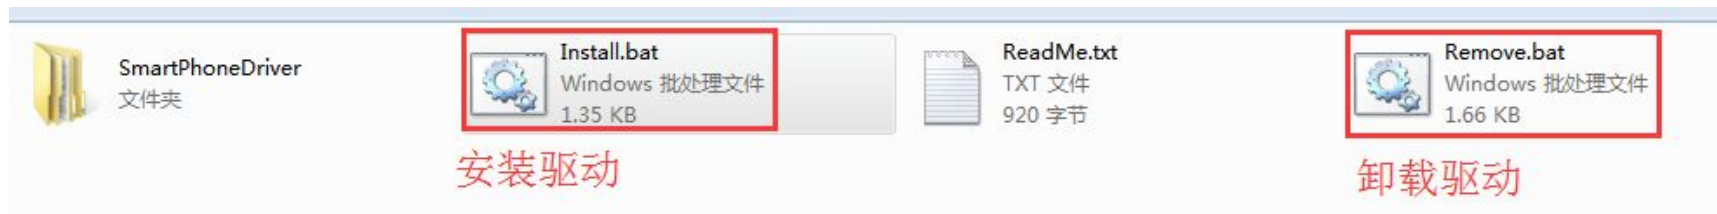

如果已经安装驱动, 不需要执行这一步操作

USB驱动安装成功如图所示

注: Win7电脑, 尽量右击Install.bat文件“以管理员身份运行”

```
C:\Windows\system32\cmd.exe

*****Information*****
*****
Dirver Installer v1.0
Win 7
D:\工作文档\tool\USB驱动\2K_XP_COM\Driver_Auto_Installer_v1.352.00\SmartPhoneDriver\x64

*****
*****Install SP unsigned inf*****
*****
Install complete!


*****
*****Install SP signed inf*****
*****
Install complete!
```

双击




SPMultiPortFlashDownloadProject.exe
2016/2/17 16:10


图标打开程序

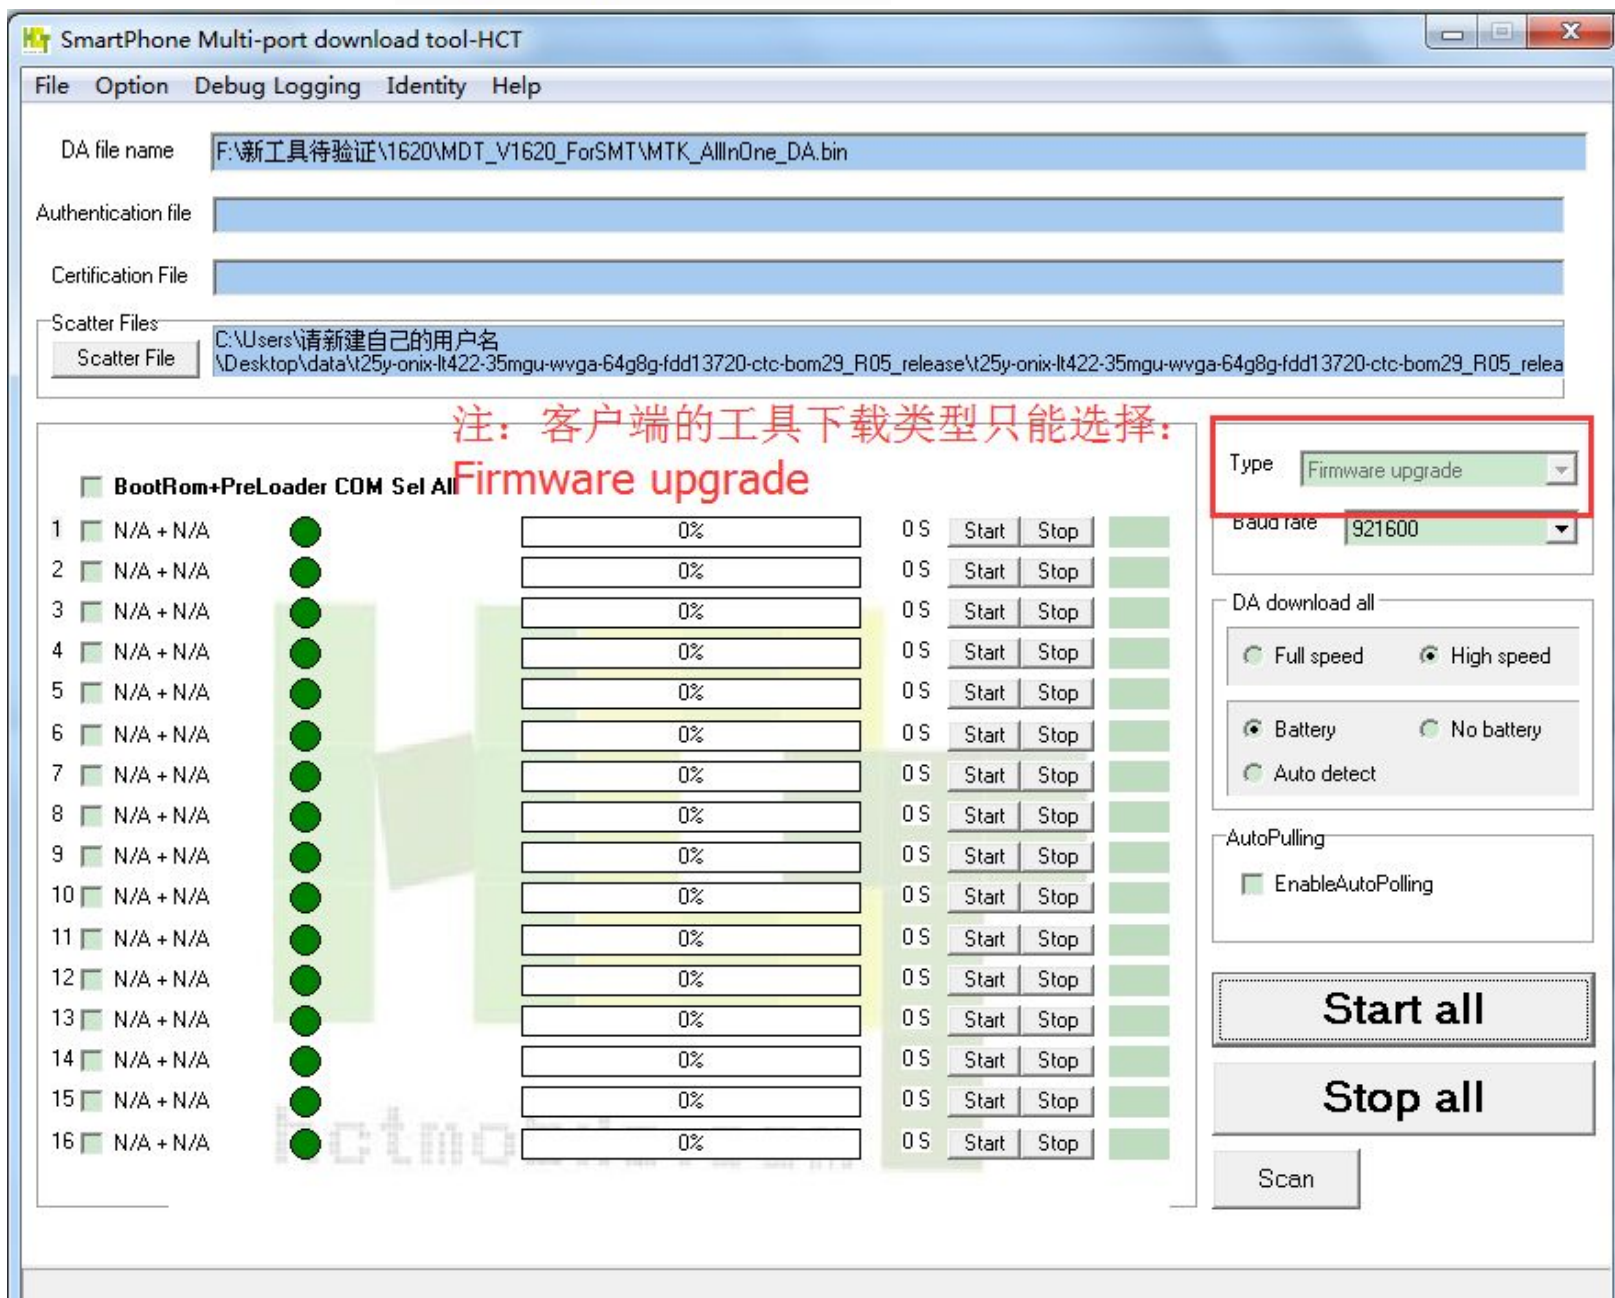


软件选择:选择对应的scatter文件

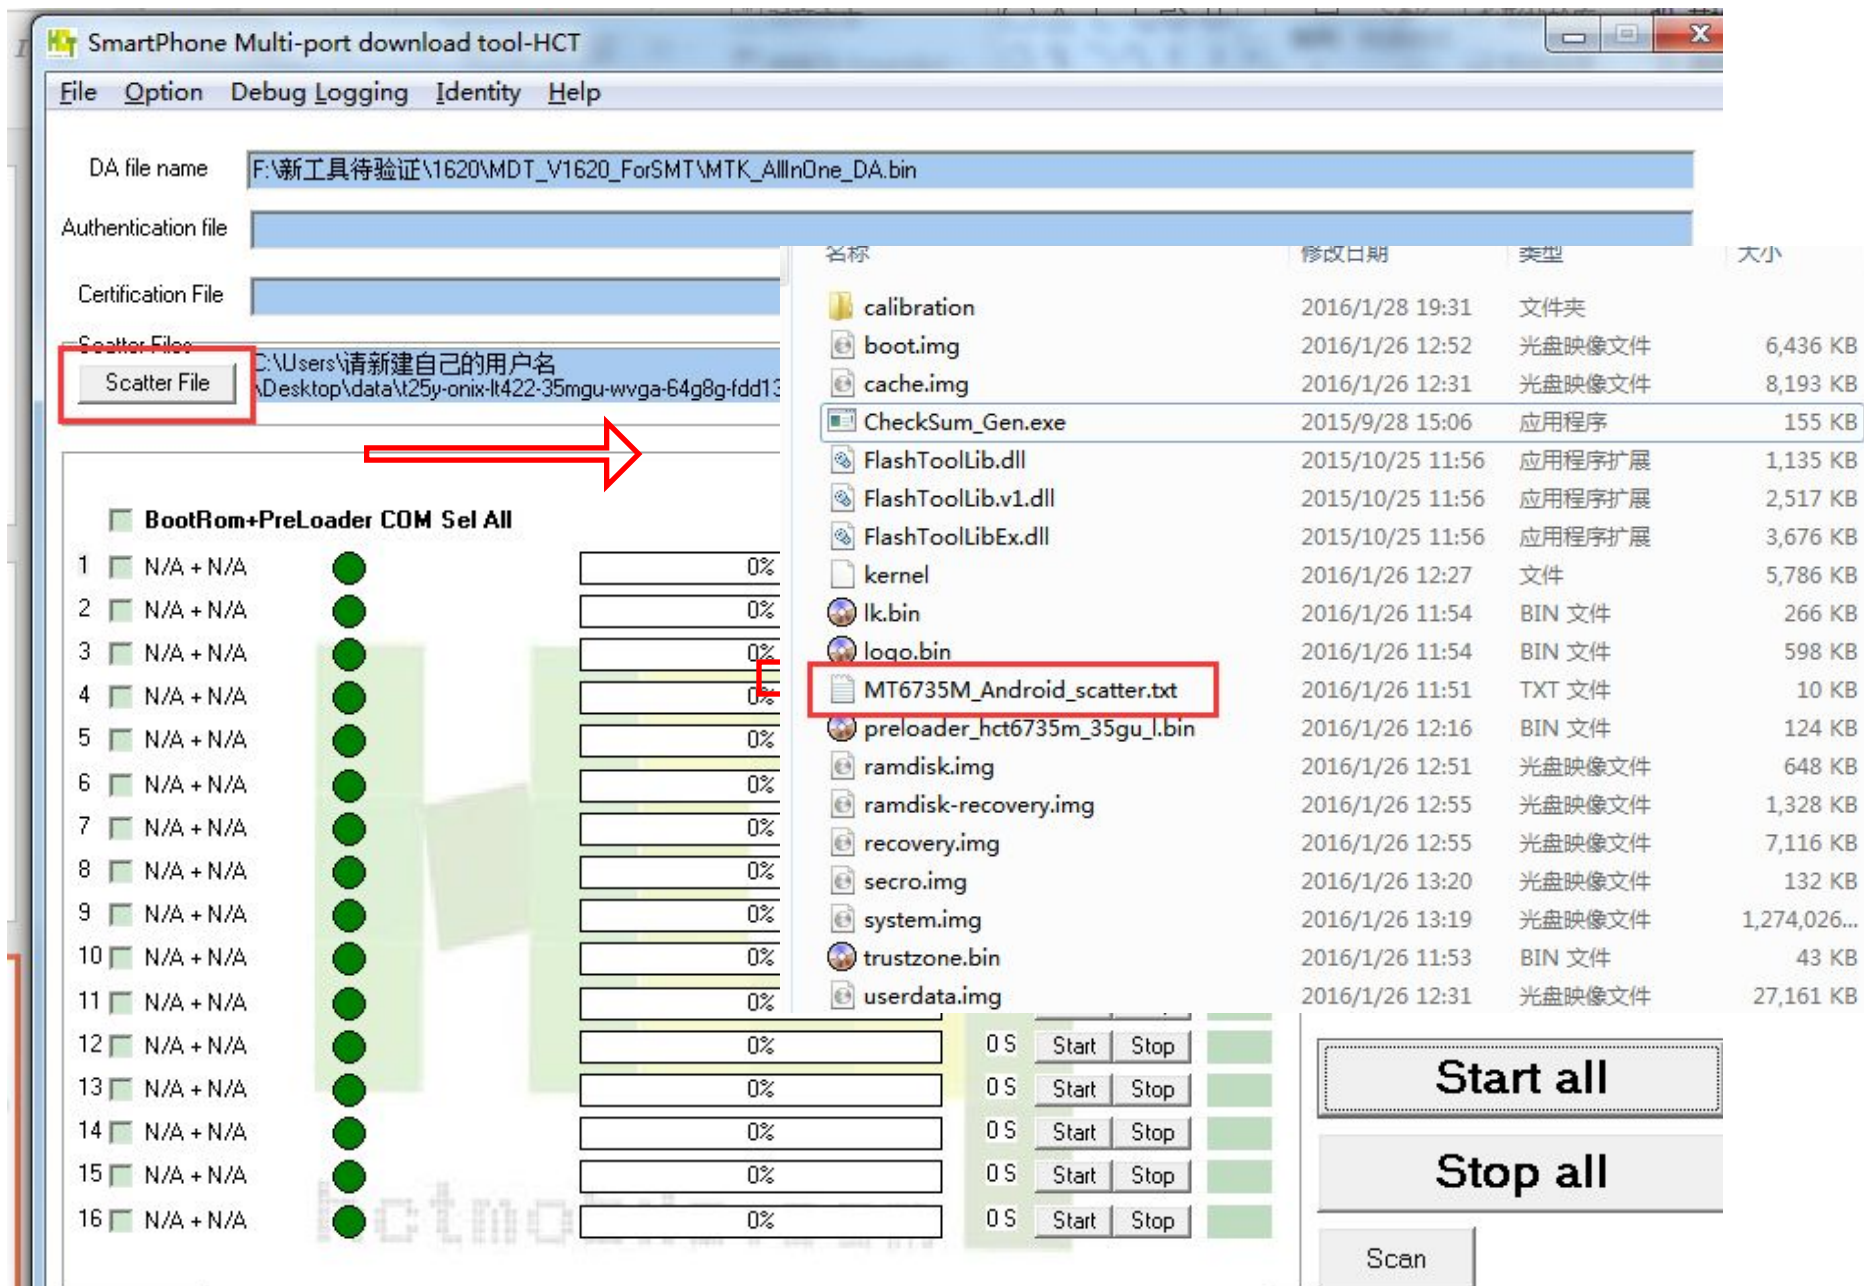


如出现如图提示, 需要在软件中运行Checksum_Gen.exe文件

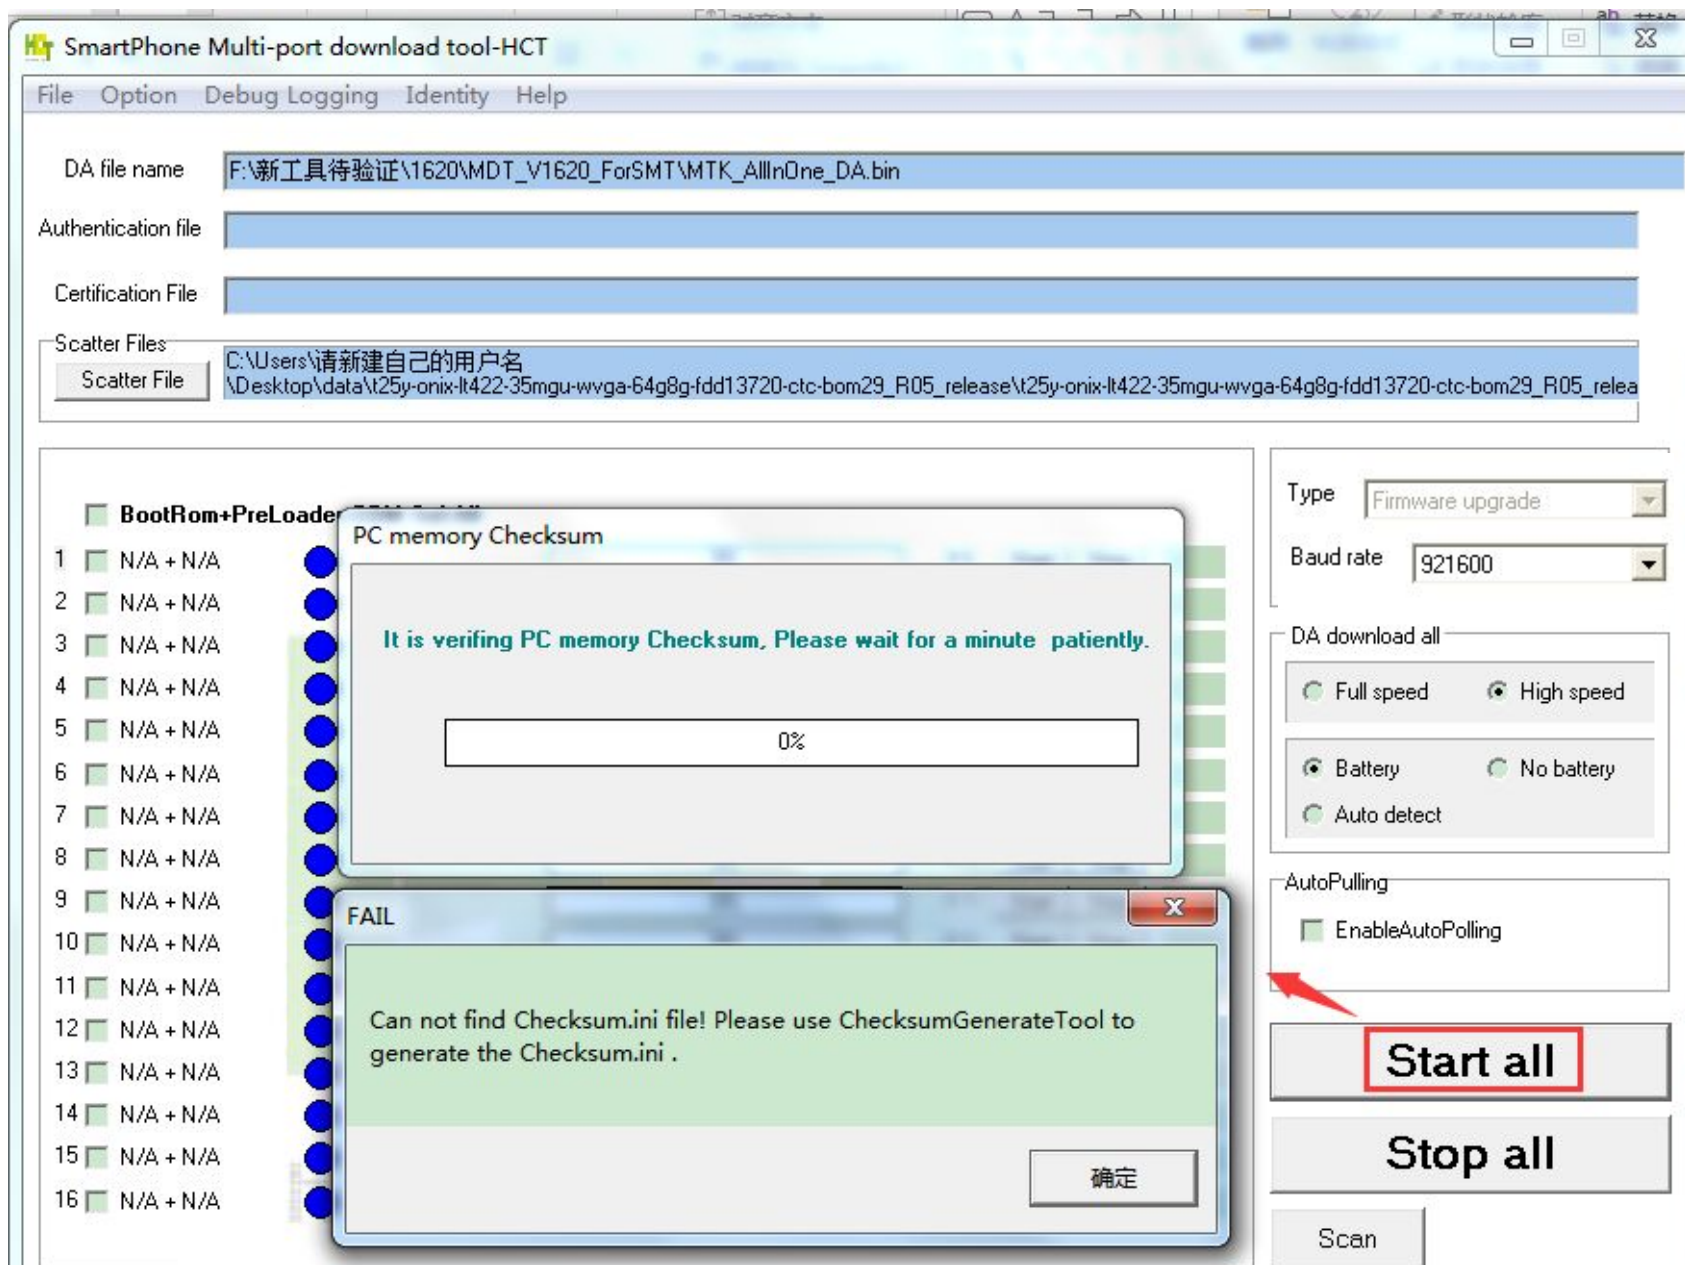

点击Scan, 出现如图所示点击是

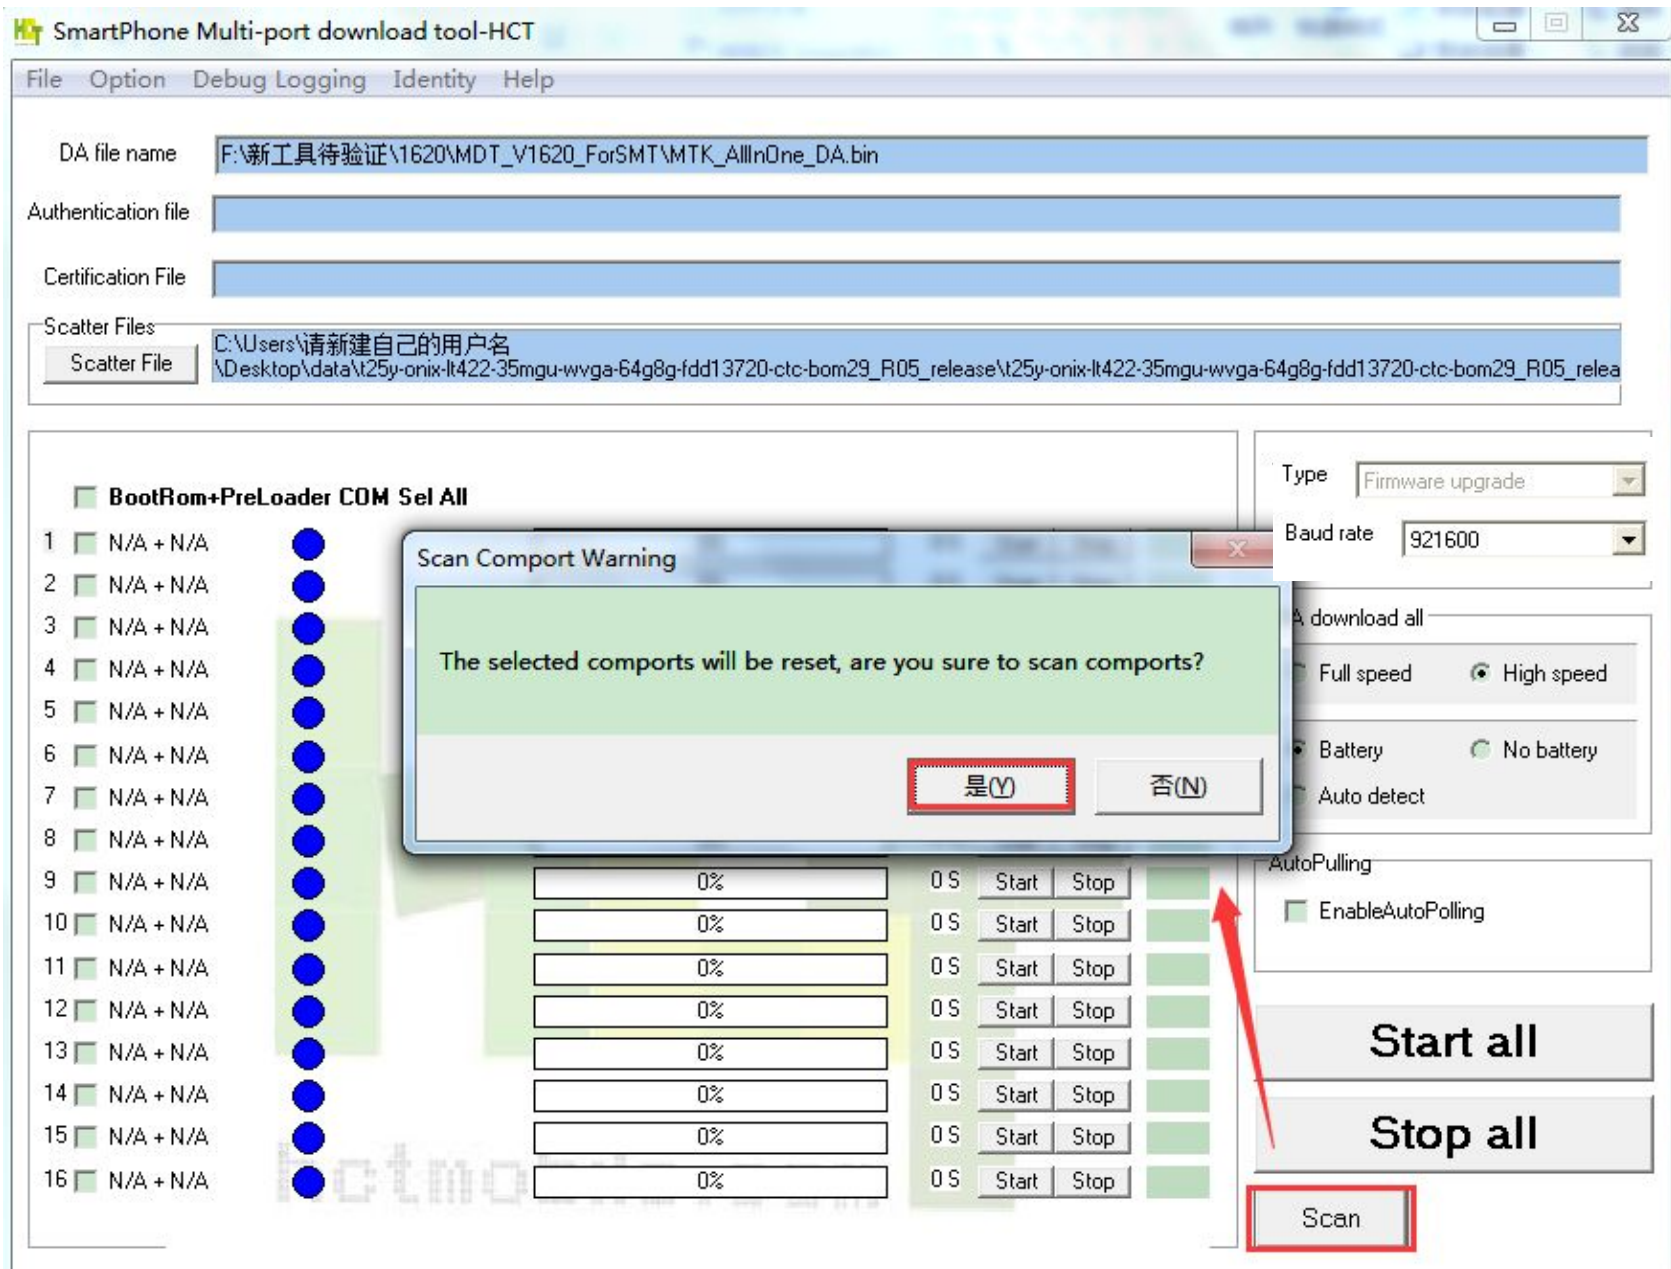

点击Scan扫口(根据需要多选)

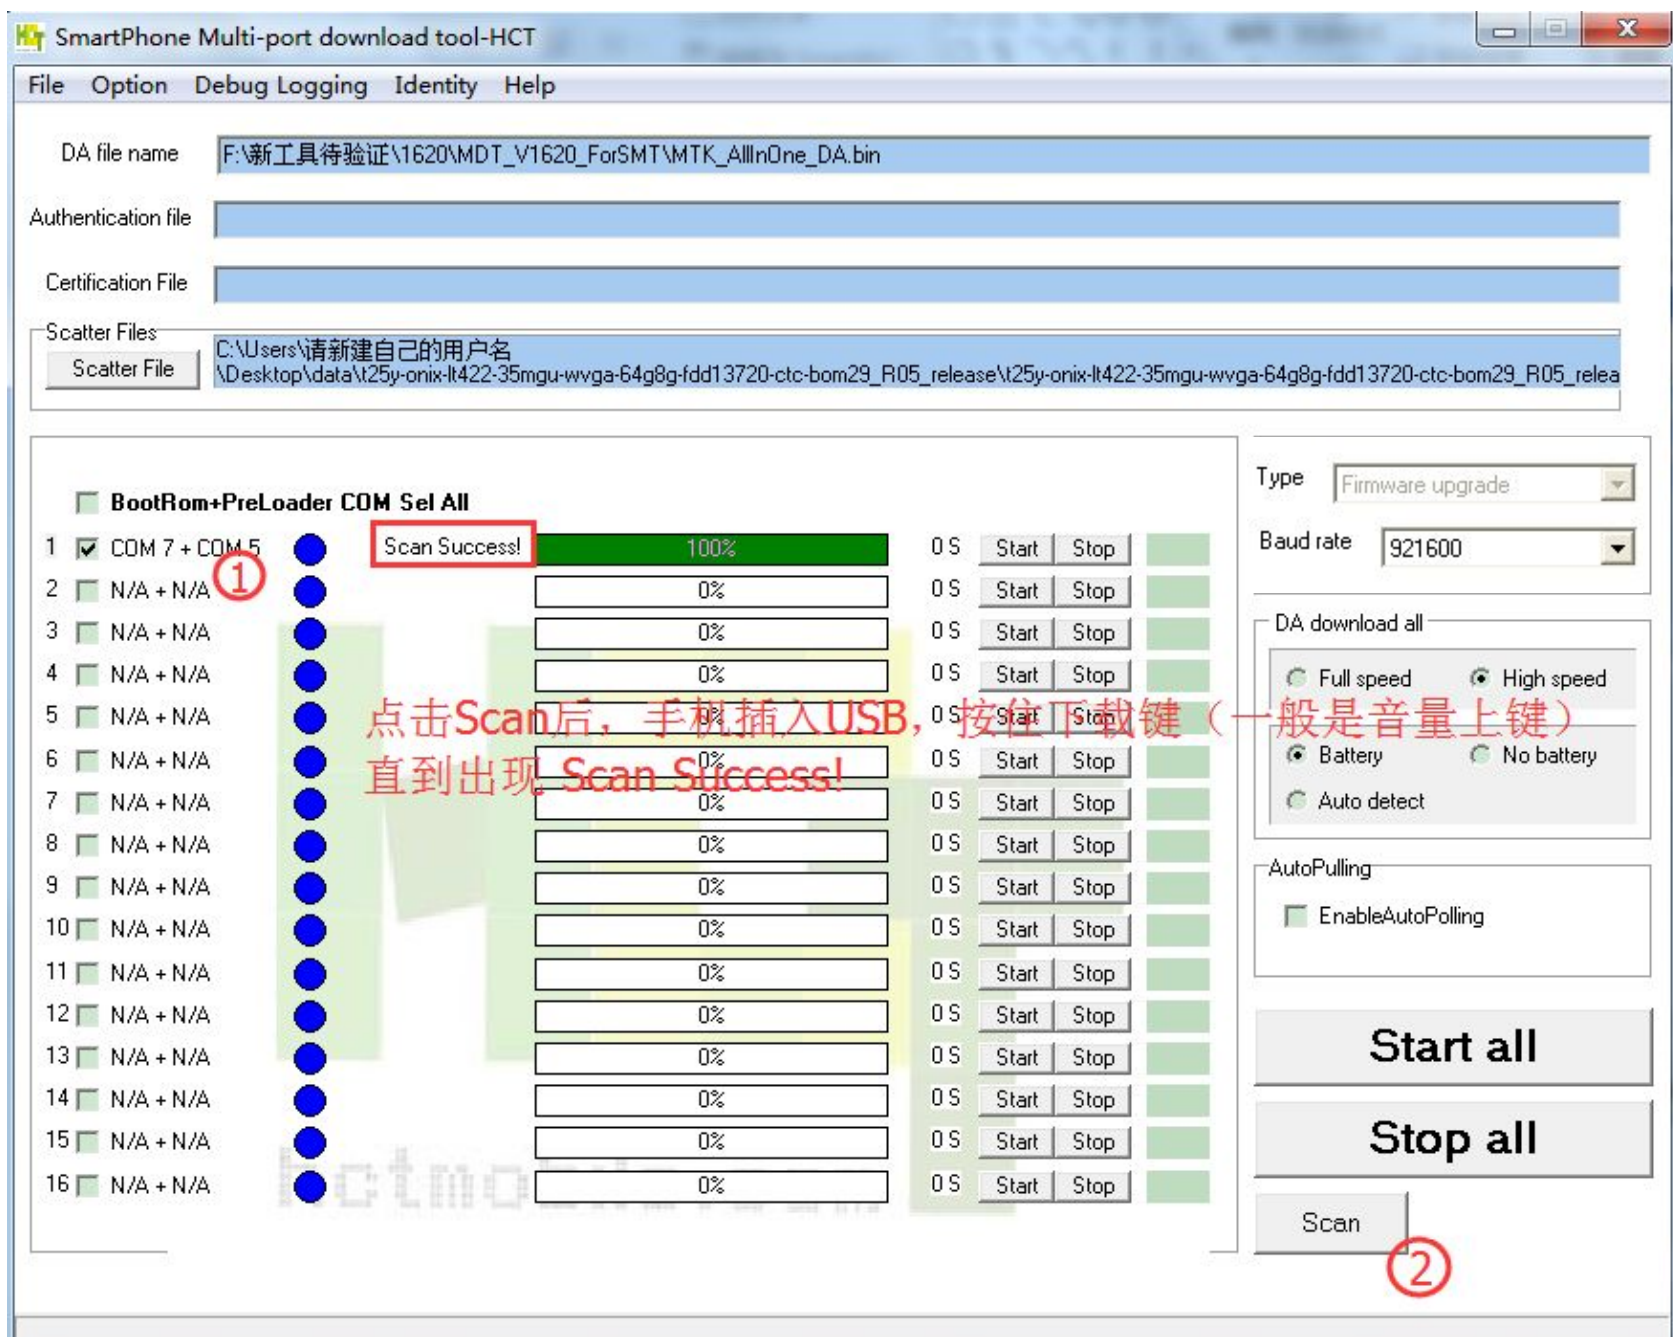

如图所示下载pass

Multi-port download tool 1620-HCT After-Sale Service Center

File Option Debug Logging Identity Help

DA file name: F:\新工具待验证\1620\MDT_V1620_ForUpgrade\MTK_AllnOne_DA.bin

Authentication file:

Certification File:

Scatter Files: E:\Ruan Jian\823ax-ot-t922-63pu-hd-128g8g-bom75-tiepian_R01_release\MT6735M_Android_scatter.txt

Scatter File:

☐ BootRom+PreLoader COM Sel All

| | | | DL OK | | | | | |
|----|---|---|-------|------|-------|-------|------|------|
| 1 | <input checked="" type="checkbox"/> COM13 + COM 4 | ● | | 100% | 131 S | Start | Stop | PASS |
| 2 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 3 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 4 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 5 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 6 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 7 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 8 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 9 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 10 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 11 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 12 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 13 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 14 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 15 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |
| 16 | <input type="checkbox"/> N/A + N/A | ● | | 0% | 0 S | Start | Stop | |

Type: Firmware upgrade

Baud rate: 921600

DA download all

☐ Full speed ☒ High speed

☒ Battery ☐ No battery

☐ Auto detect

AutoPulling

☐ EnableAutoPolling


Start all

Stop all


Scan

Format EMMC flash: begin_addr (0x0000000084000000), length (0x000000031ED80000). Auto Polling number:0


MTK_AllinOne_DA.bin重新设置

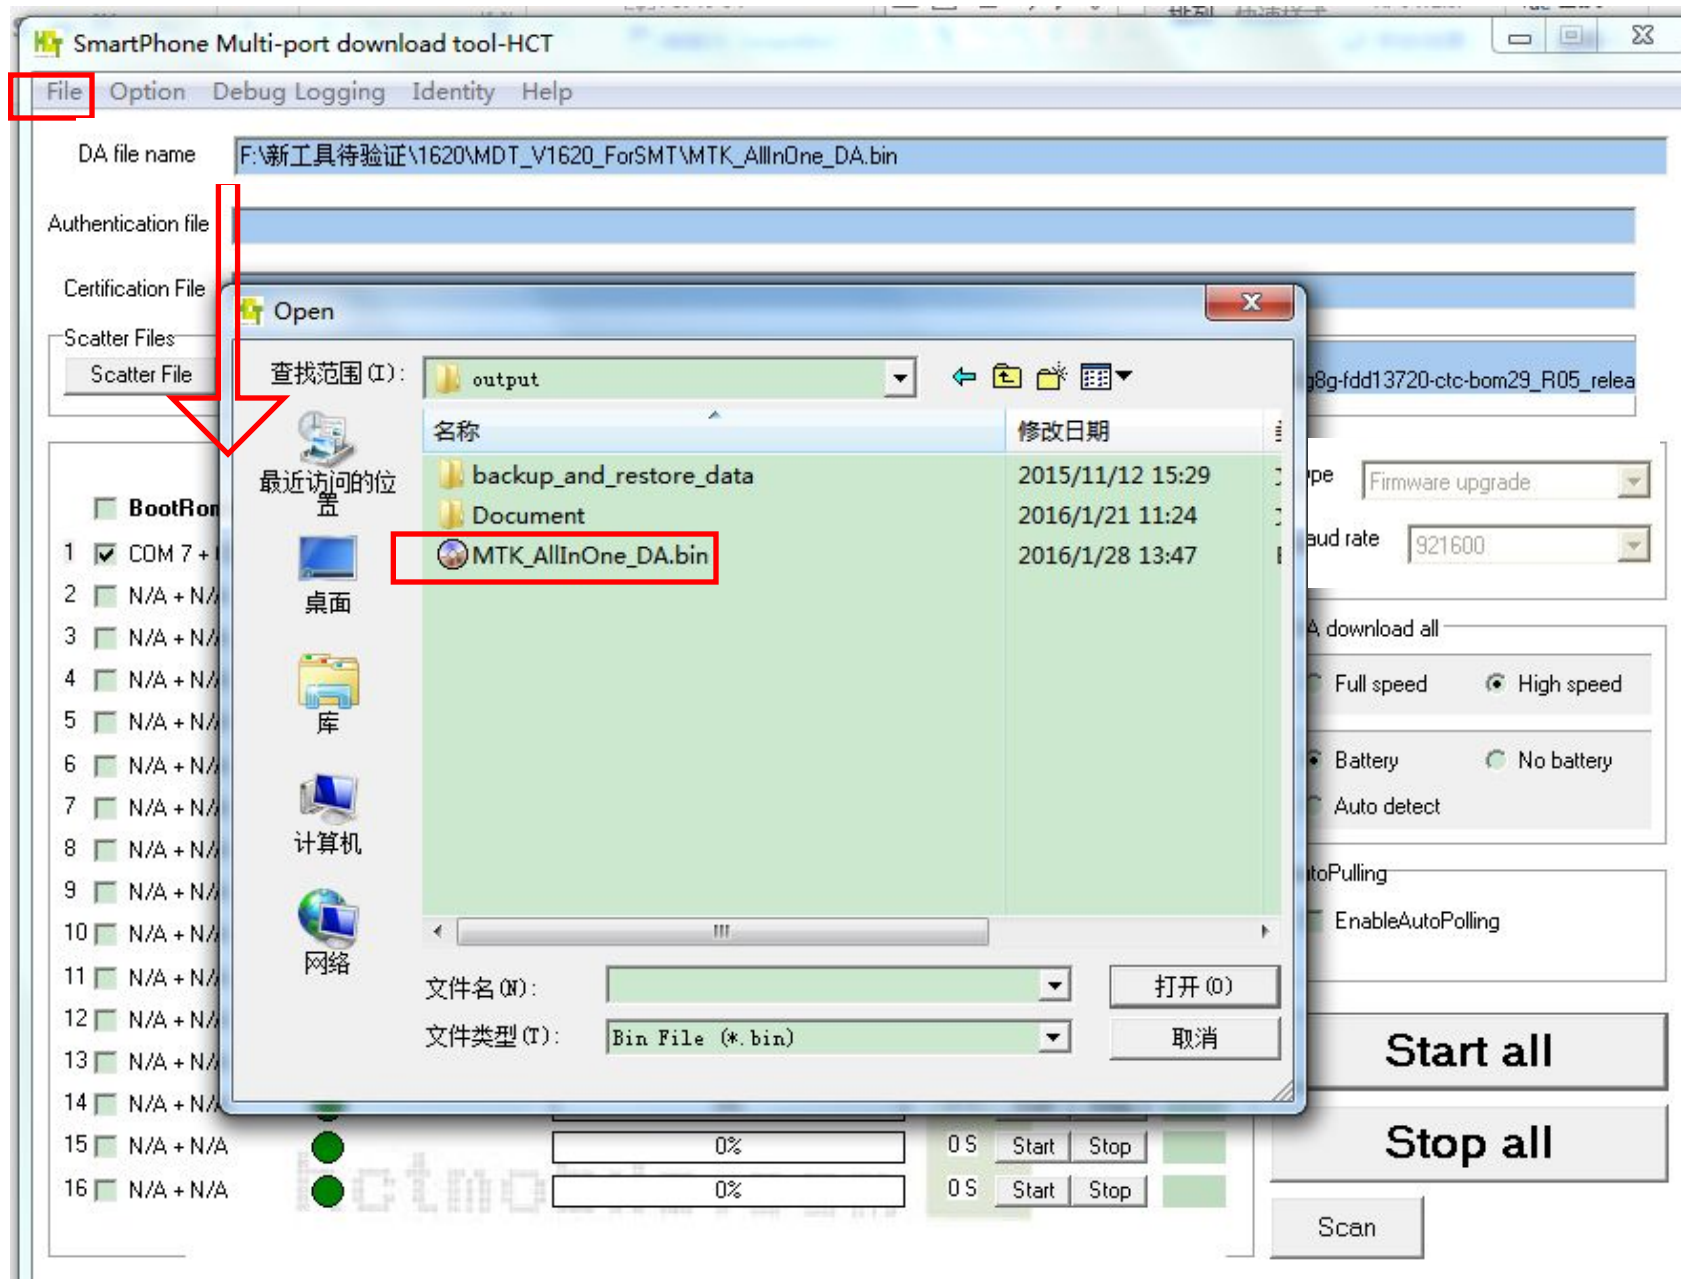


工具解锁设置

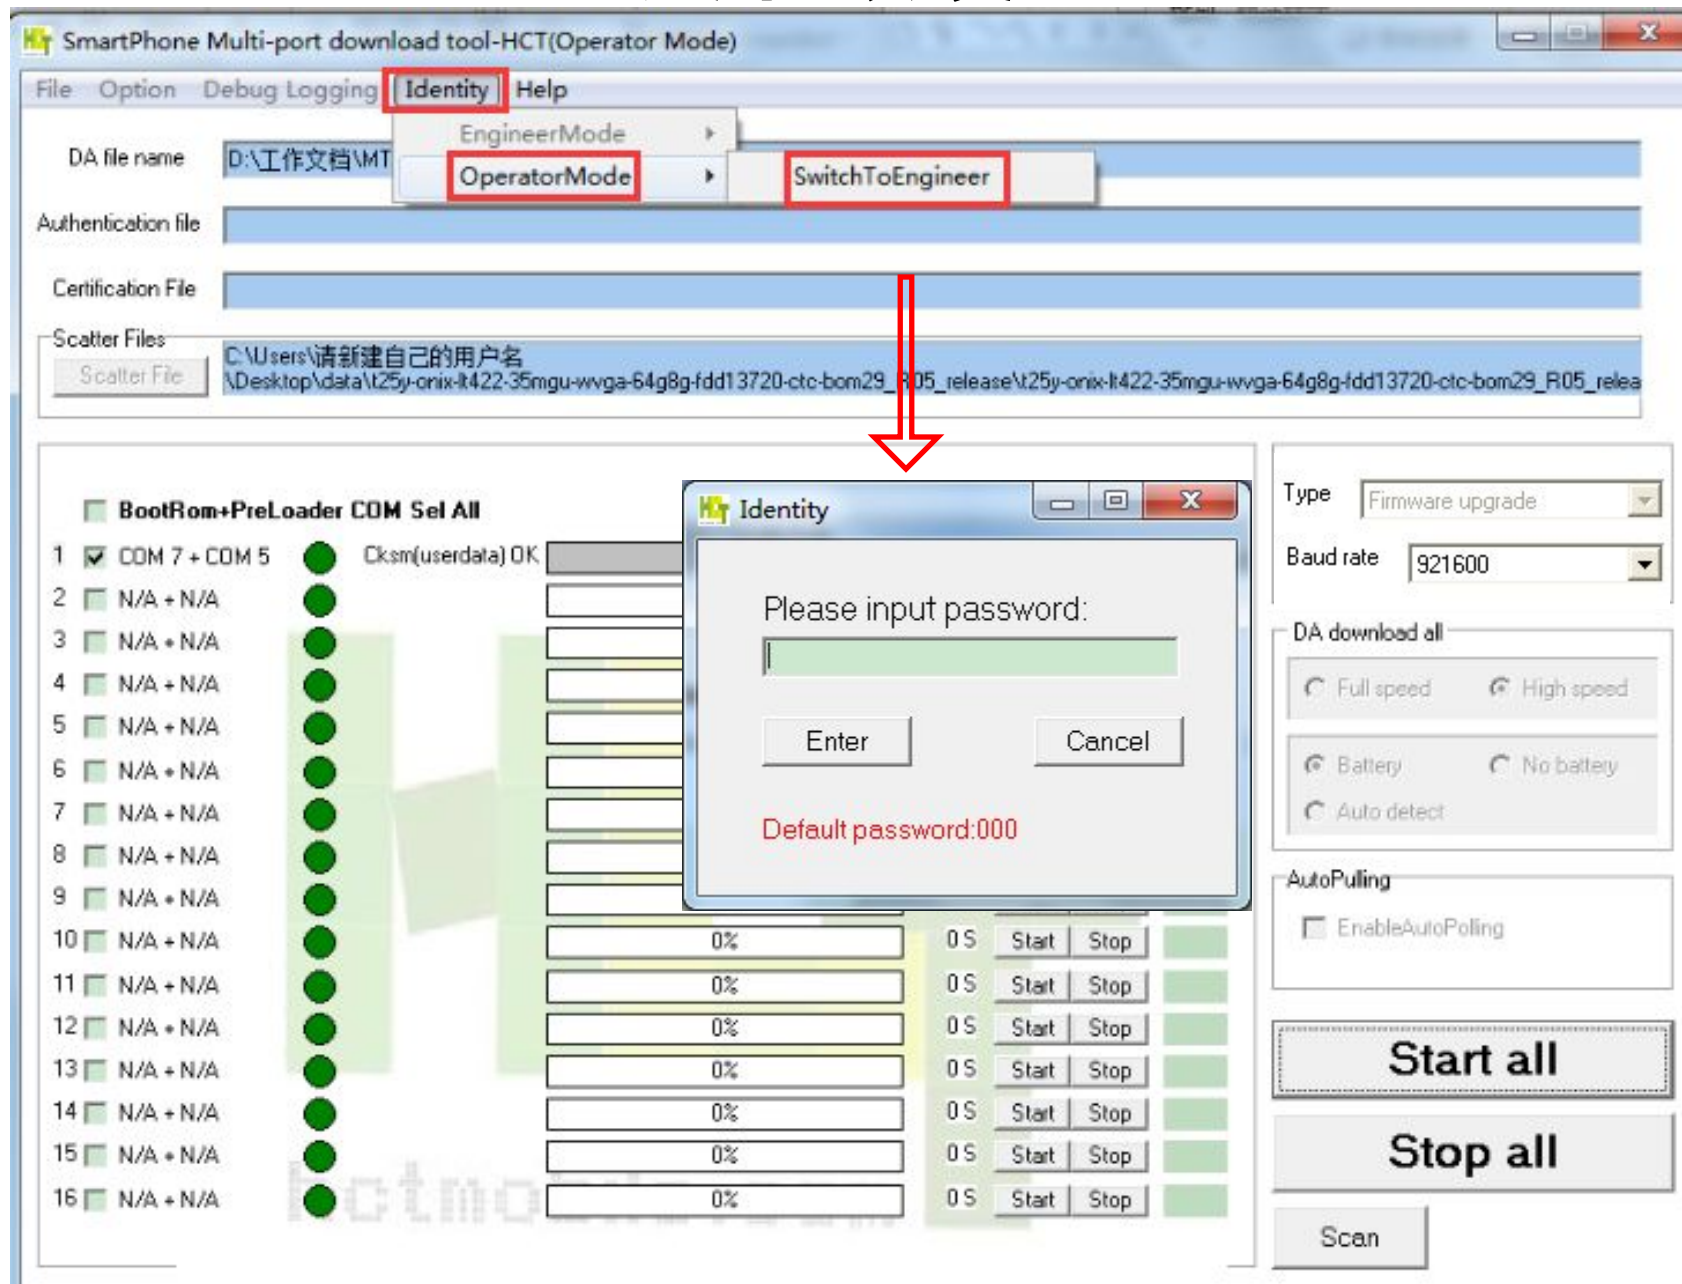


工具密码更改

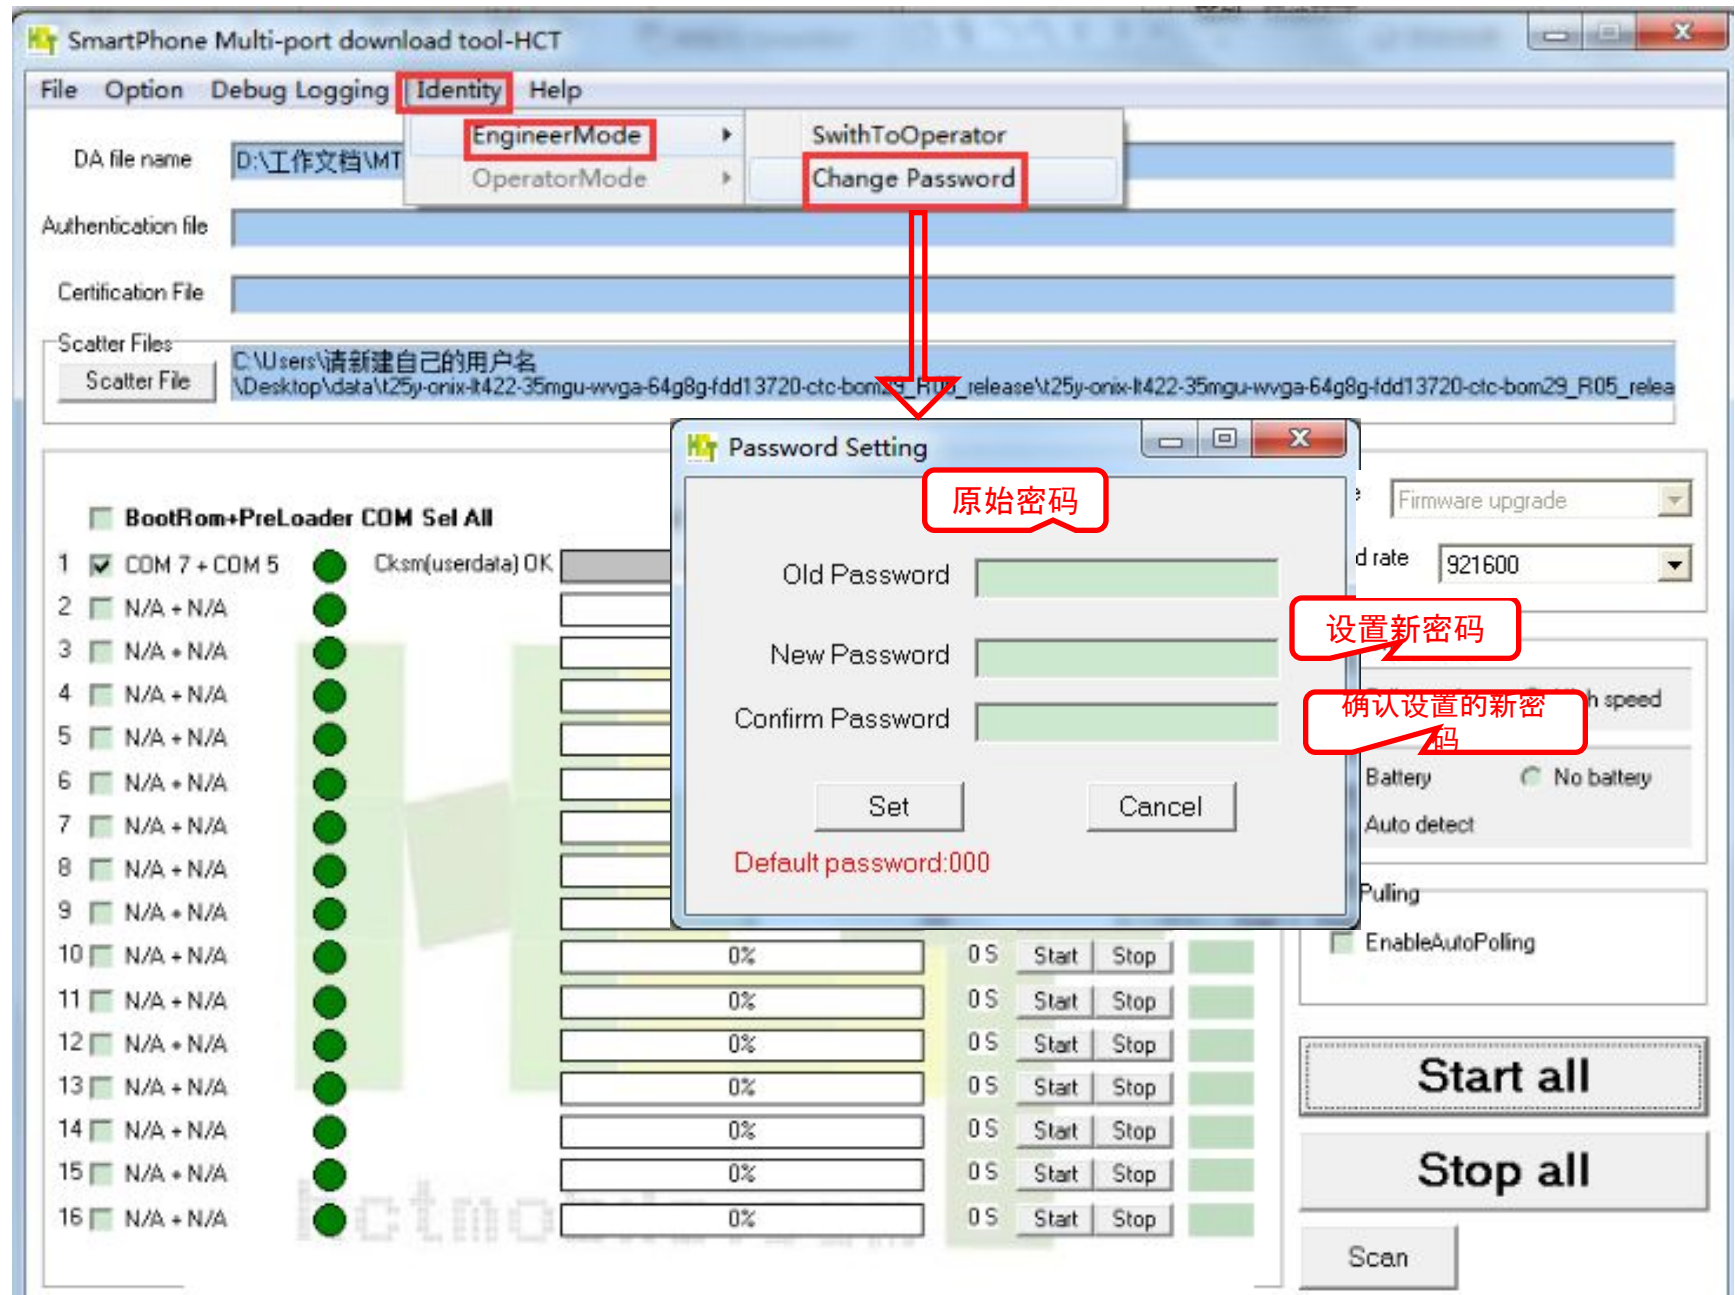

SwitchToOperator之后设置与软件不可修改

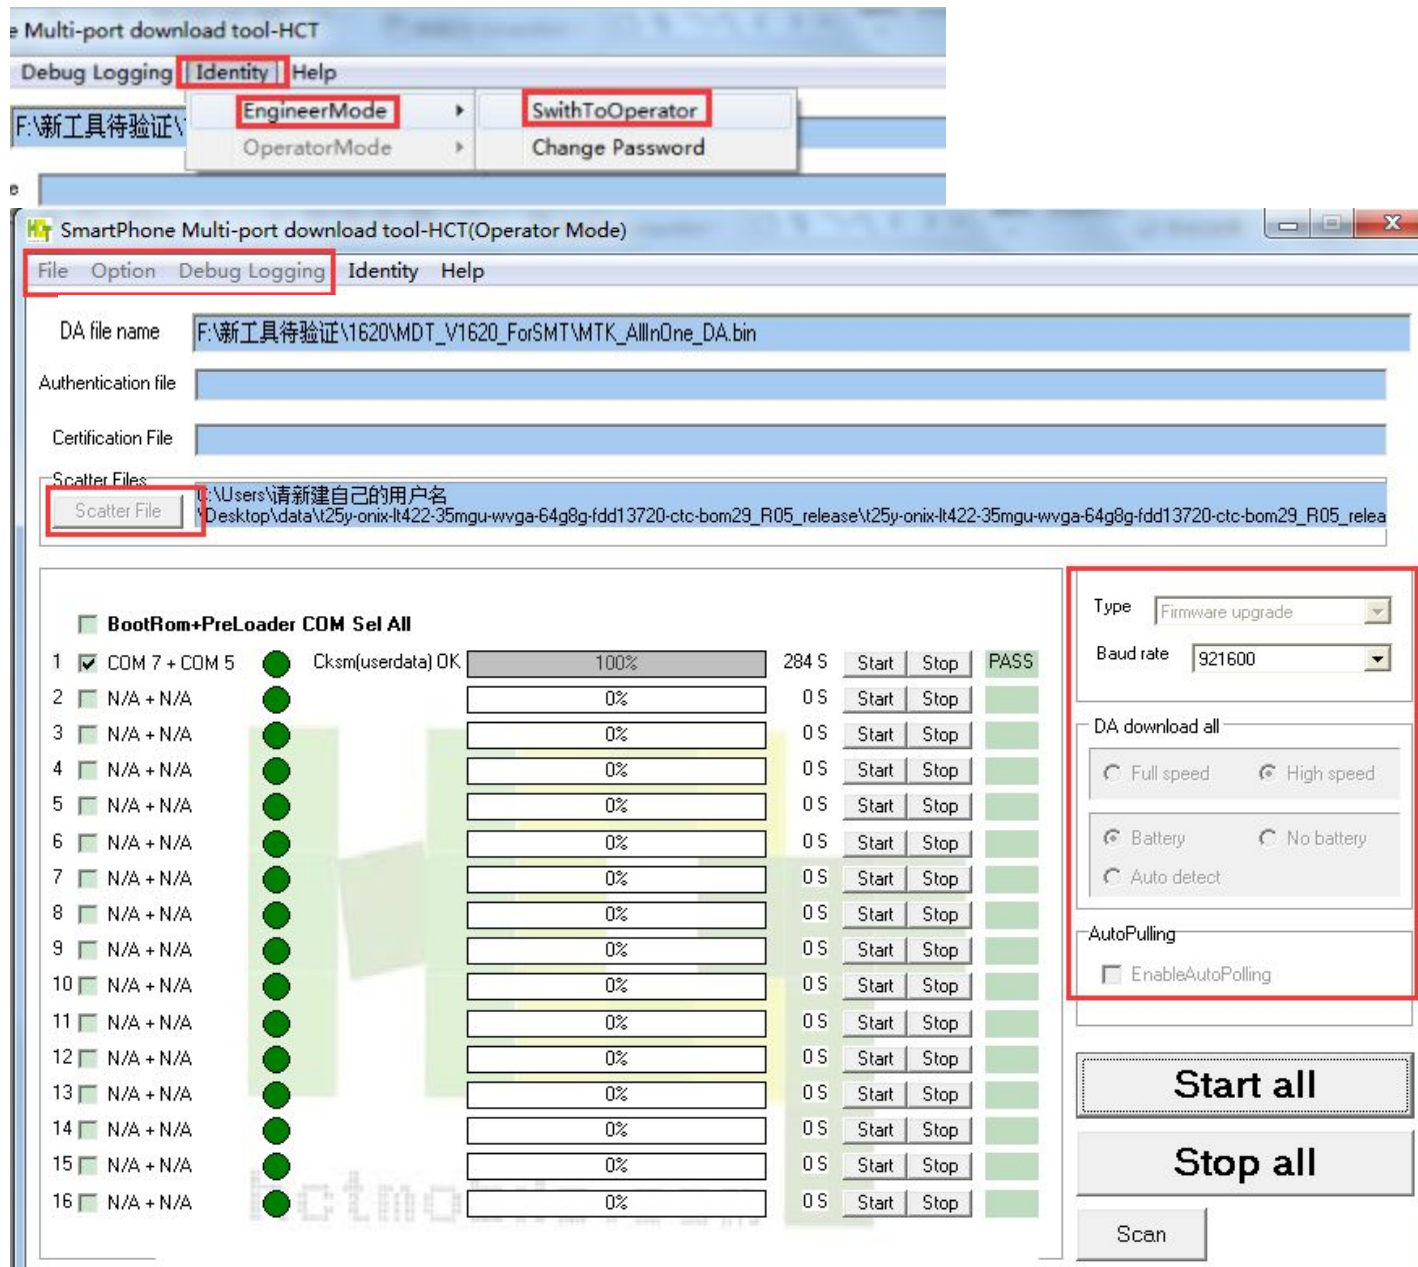

点击Start all出现如图所示

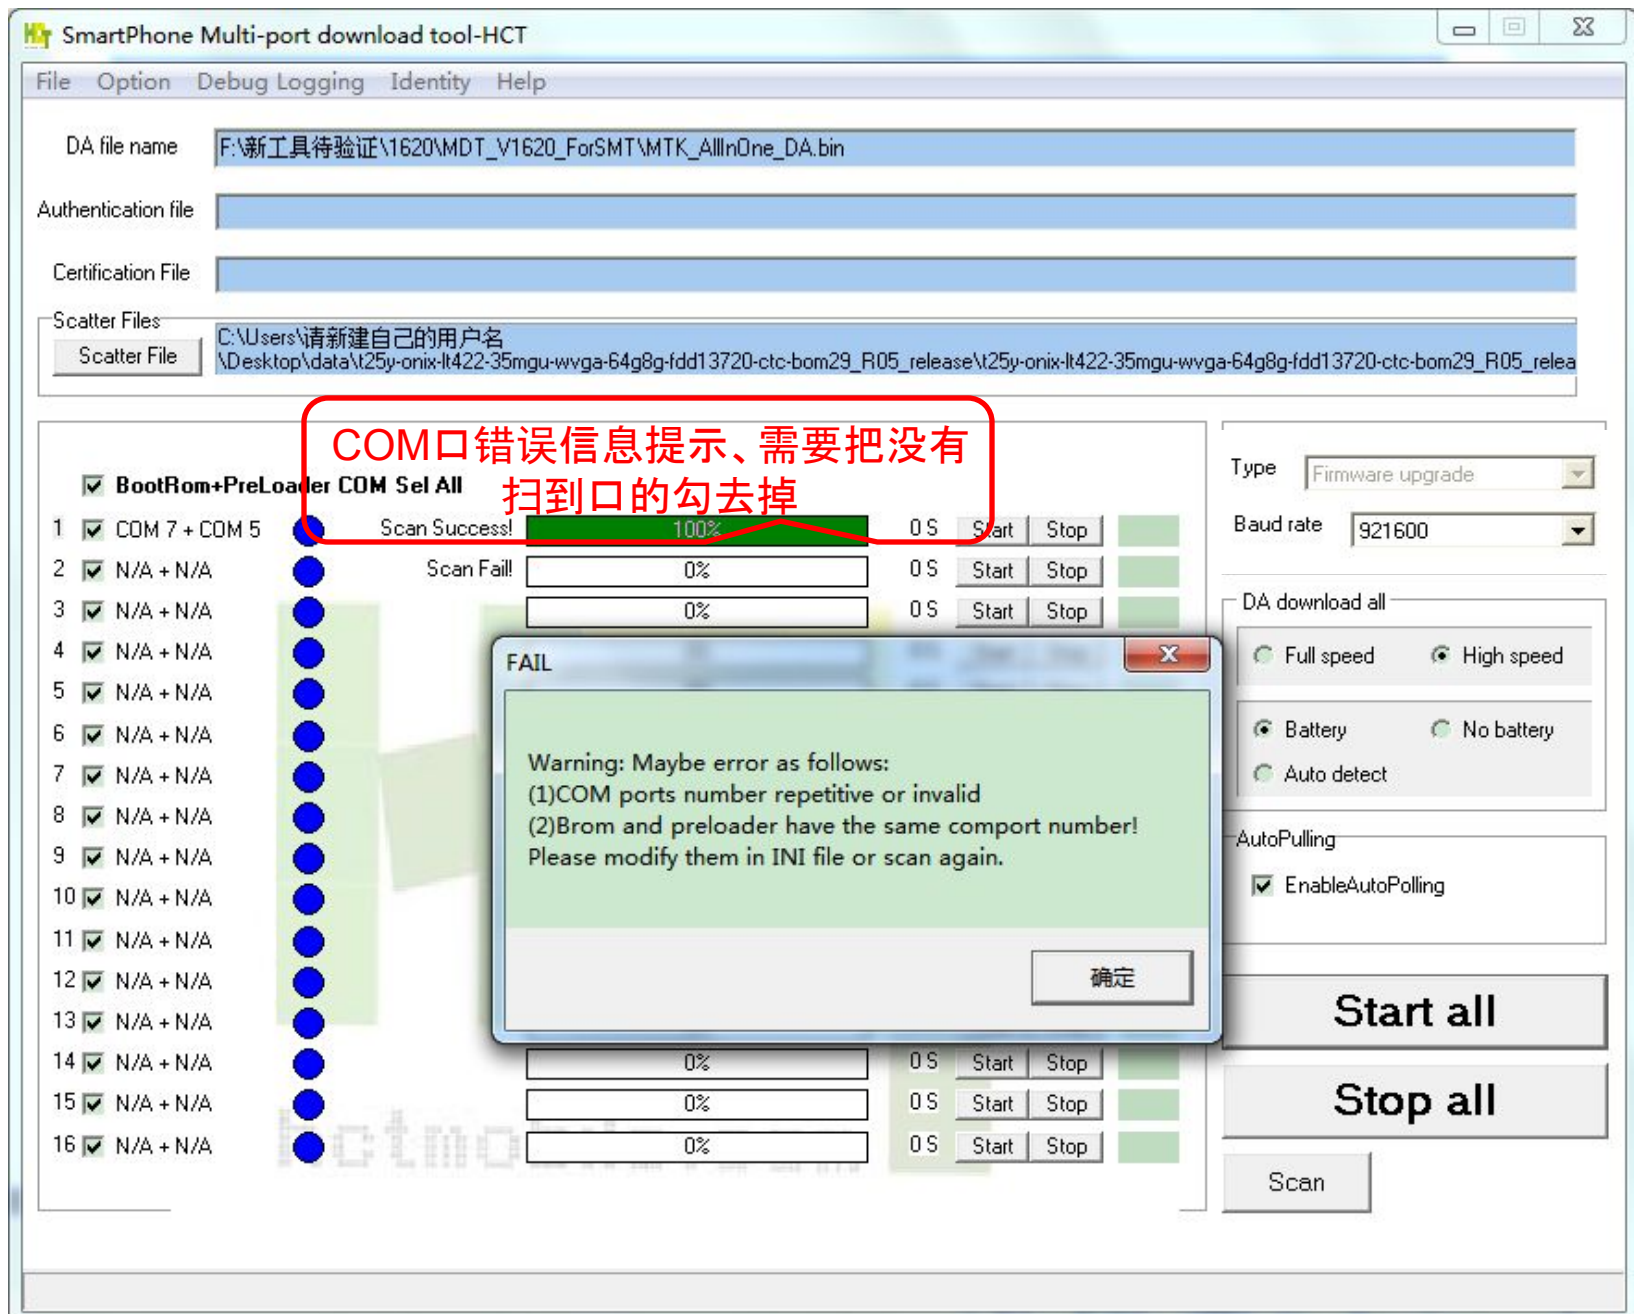

其他设置说明

- 其他设置如图:加载模式, 和供电模式选择

- 供电模式:

Battery:带电池

No battery:不带电池

Auto detect:自动检测



- 加载类型:

Firmware upgrade:备份重要信息(像NV)到电脑 □ 格式化 □ 加载 □ 从电脑端恢复备份的信息到手机()

备注:如果工具在配置时出现:

The memory buffer for loading image verification fail !

请检查软件中是否有checksum.ini文件,

如果没有, 需要 CheckSum_Generate.exe 工具放到软件中运行检查手机软件的地址是否正确

